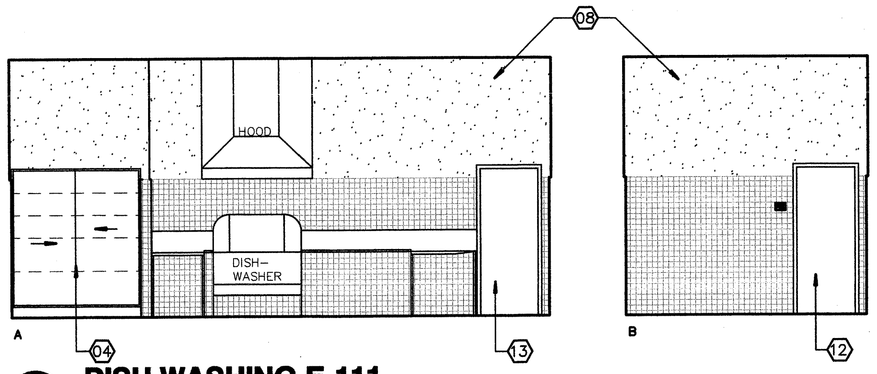

E1 DISH WASHING E-111
1/4"=1'-0"

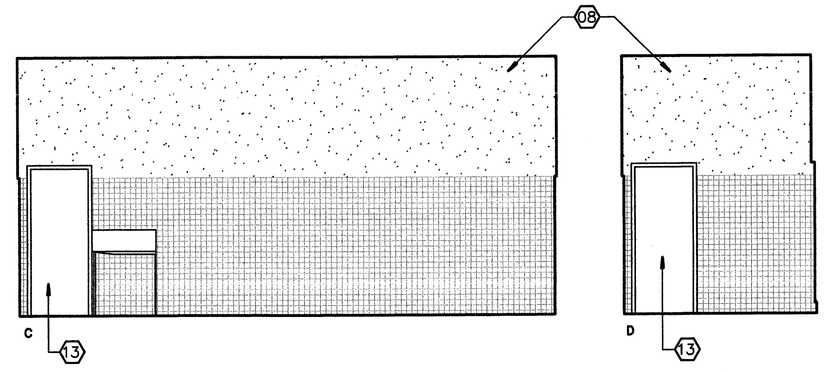

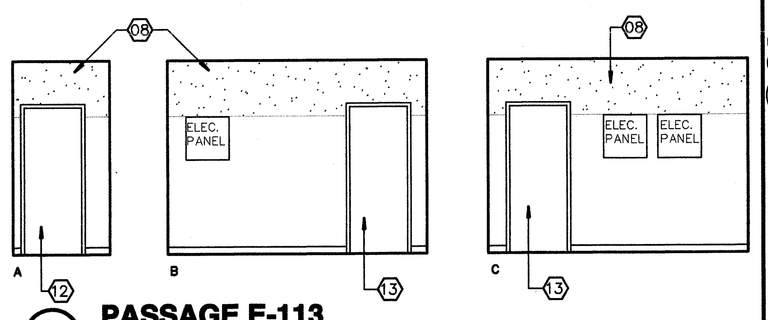

E4 PASSAGE E-113
1/4"=1'-0"

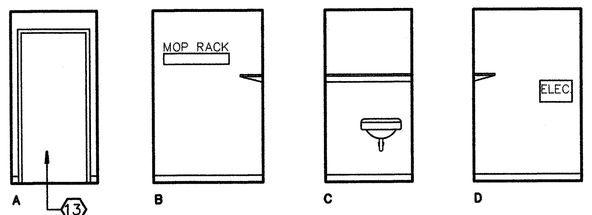

D1 CUSTODIAN E-114
1/4"=1'-0" (NO WORK EXCEPT DOOR)

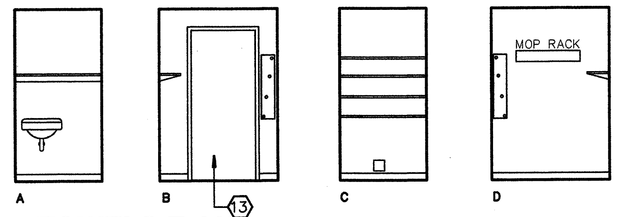

D2 TOWELS E-115
1/4"=1'-0" (NO WORK EXCEPT DOOR)

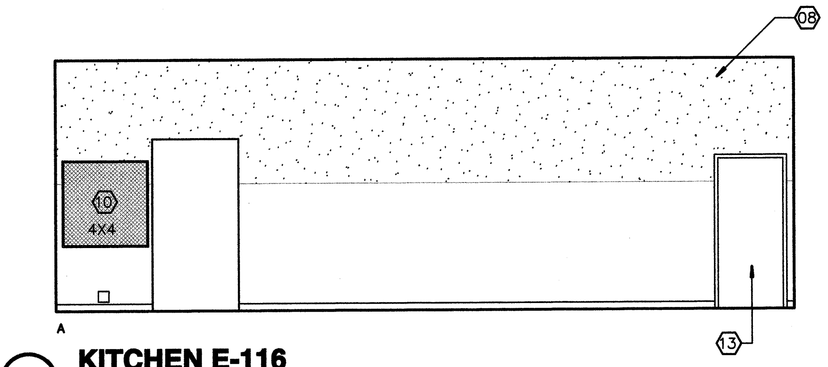

D4 KITCHEN E-116
1/4"=1'-0"

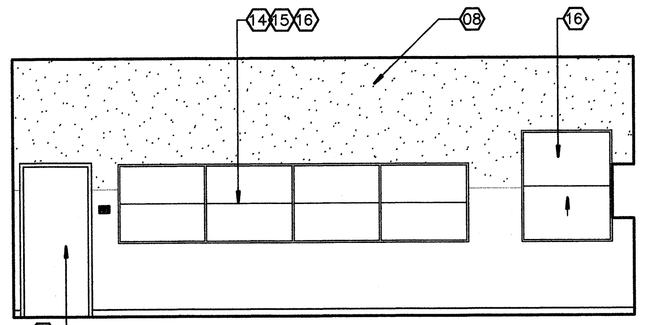

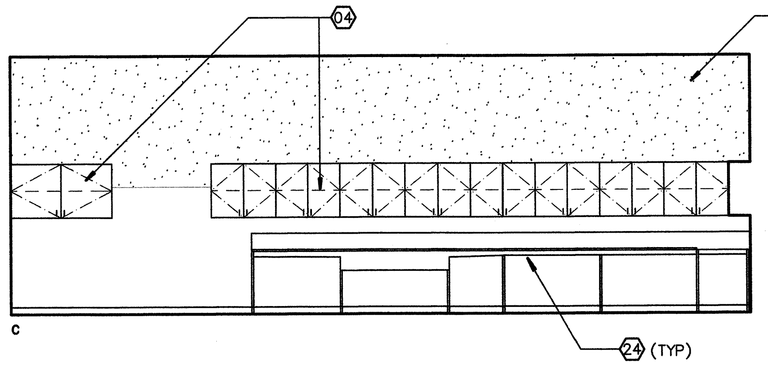

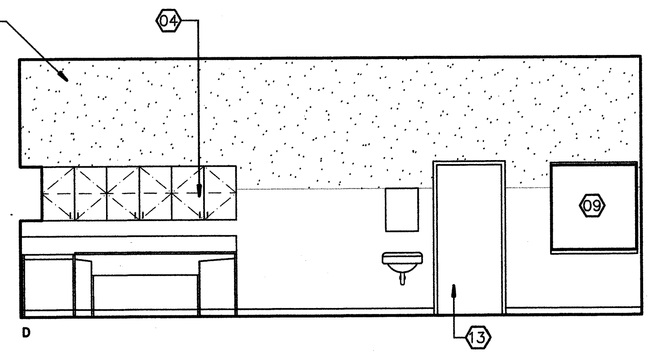

C1 KITCHEN CONTINUED
1/4"=1'-0"

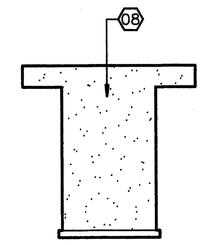

C5 SUPPLY E-117
1/4"=1'-0"

OMIT

1. REMOVE (E) RUBBER BASE WHERE OCCURS–PROVIDE/INSTALL RTSB.
2. REMOVE/REPLACE (E) COUNTERTOP W/PLASTIC LAMINATE COUNTERTOP W/6" SPLASH, (UNO) CAULK AT WALL.
3. MODIFY SINK CABINET TO PROVIDE 30"W x 27"H CLEAR KNEE SPACE UNDER SINK, REMOVE/REPLACE BASE SHELF, RIGHT SIDE CABINET. RETURN FLOORING TO BACK WALL, REMOVE/REPLACE (E) COUNTERTOP & SPLASH W/PLASTIC LAMINATE COUNTERTOP W/6" SPLASH (UNO), (CAULK SPLASH @ WALL). REMOVE/REPLACE SINK–SEE PLUMBING DWGS. INSULATE SUPPLY/DRAIN LINES (COUNTERTOP TO EXTEND OVER OPENING WHERE METAL FILE CABINET OCCURS) 04
4. (E) CABINET TO REMAIN, REMOVE DOOR AND DRAWER PULLS, SAND ALL SURFACES, (DOORS, DRAWERS, SHELVES, ETC) TO REMOVE BUILT–UP PAINT, FILL DAMAGED AREAS, PREP & PAINT– REINSTALL HARDWARE.
5. MAINTAIN (E) OPEN SPACE FOR METAL FILE CABINET.
6. PROVIDE/INSTALL PAPER TOWEL DISPENSER–SEE SPECIFICATIONS.
7. PATCH/FILL DAMAGED WALLS AS REQUIRED, PREP– PAINT (E) PLYWOOD WALLS.
8. PATCH/FILL DAMAGED WALLS AS REQUIRED, PREP– PAINT (E) PLASTER FINISH WALLS.
9. REMOVE/REPLACE CHALK BOARDS W/LIQUID MARKER BOARDS SEE SPECIFICATIONS.
10. REMOVE/REPLACE (E) TACKBOARDS–SEE SPECIFICATIONS SEE DETAIL A6/A–231 FOR MOUNTING REQUIREMENTS
11. REMOVE ABANDON HEATER UNIT, CAP ALL SUPPLY/RETURN LINES BEHIND WALL, REMOVE VENT OPENING @ EXTERIOR WALL, INFILL MATCH 2X FRAMING, INSTALL INSULATION, PATCH–MATCH FINISHES–PAINT.
12. (E) DOOR/FRAME TO REMAIN, REPLACE HARDWARE W/ ACCESSIBLE HARDWARE. SEE DOOR SCHEDULE, SAND PREPARE DOOR SURFACE, PAINT EXTERIORS, RE–STAIN PREVIOUSLY STAINED AREAS WHERE OCCURS.
13. (E) DOOR/FRAME TO REMAIN. SEE DOOR SCHEDULE. SAND PREPARE DOOR SURFACE, PAINT EXTERIORS, RE–STAIN PREVIOUSLY STAINED AREAS WHERE OCCURS.
14. @ WINDOWS CLEAN/PRIME TUBE STEEL MULLIONS–PAINT
15. @ WINDOWS CLEAN/PRIME PAINTED METAL WINDOW FRAME–PAINT
16. @ WINDOWS CLEAN/PRIME WOOD TRIM (JAMB/SILL/HEAD WH/OCCURS)–PAINT.
17. (E) WALL MOUNTED TV/BRACKET TO REMAIN.
18. REMOVE (E) TROUGH SINK, PROVIDE/INSTALL PLASTIC LAMINATE COUNTER W/6" SPLASH & H.C. ACCESSIBLE SINK–CONNECT TO (E) SUPPLY/WASTE LINES–SEE PLUMBING DWGS. BREAK OUT TILE AS REQUIRED FOR INSTALLATION OF BLOCKING FOR COUNTERTOP–PATCH TILE–MATCH FINISHES.
19. REMOVE (E) WOOD SHELF/COAT ROD/HOOKS, PROVIDE/INSTALL PLASTIC LAMINATE SHELF @ SAME LOCATION–MATCH HEIGHT & DEPTH OF REMOVED SHELF.
20. REMOVE (E) WOOD SHELF/COAT ROD/HOOKS, PATCH WALL AS REQUIRED, PAINT PLYWOOD WALL.
21. PREP(E) WOOD COUNTERTOP & ANGLED SHELVES–PAINT.
22. MODIFY (N) COUNTERTOP @ H.C. SINK CABINET TO PROVIDE 27" CLEAR KNEE SPACE.
23. (E) C.T. BASE TO REMAIN
24. (E) KITCHEN EQ TO REMAIN NO WORK
25. CUT OPENING AND FRAME FOR RETURN AIR DUCT IN NON–BEARING WALL SEE MECHANICAL DWGS. PATCH AND MATCH WALL FINISHES AS REQUIRED
26. (E) DUCT OPENING–TIE SUPPLY AIR FROM HVAC ON ROOF–SEE MECHANICAL DWGS. 04
27. CUT OPENING FOR SUPPLY/RETURN DROPS FOR (N) HVAC ON ROOF. PATCH CEILING FINISH–MATCH FINISH, SEE STRUCTURAL DWG'S DTL 23/S100, 7/S101 & PARTIAL ROOF FRAMING PLAN S/201, SEE MECHANICAL DWG'S.

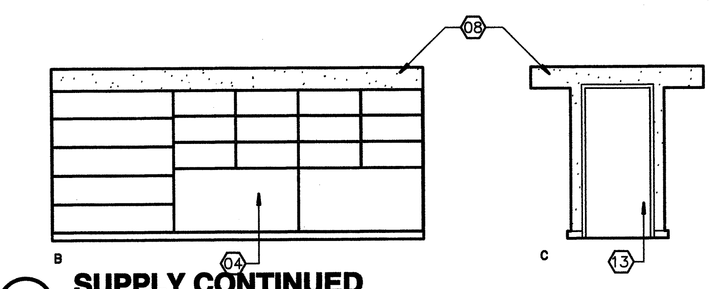

B1 SUPPLY CONTINUED
1/4"=1'-0"

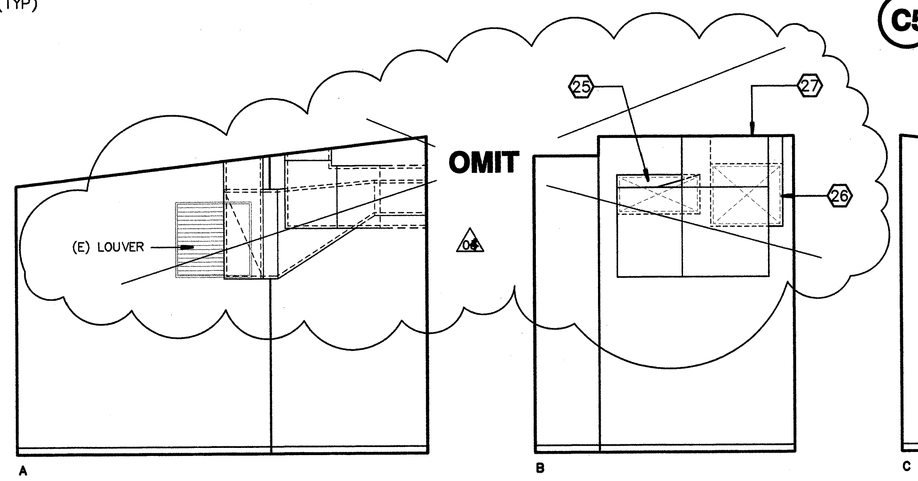

B3 MECHANICAL E-118
1/4"=1'-0"

Item No. 16: Refer to Sheet A-238
Interior Elevation "B3" Elevation "A" & "B" omit all references to HVAC related work only. Revise Keynote #4 to read. "Existing cabinet to remain, remove and replace all doors, drawer fronts, & face plates. Finish per specifications." Delete Keynotes #'s 2,3,25, 26, & 27.

Addn #4

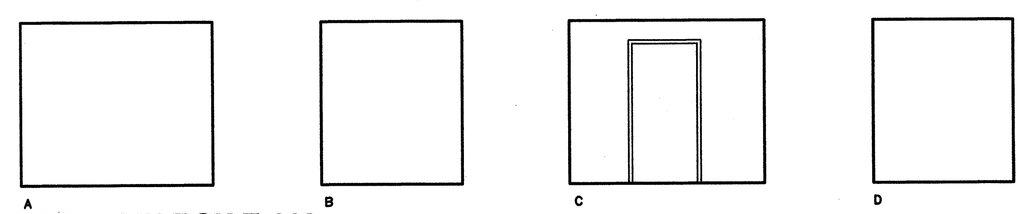

A1 WALK-IN BOX E-119
1/4"=1'-0" (NO WORK EXCEPT DOOR)

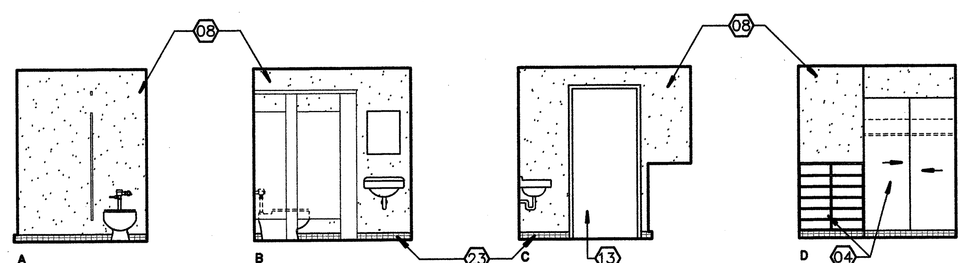

A3 COOK'S R/R E-120
1/4"=1'-0"

PLOT TIME: 12:41 PM
PLOT DATE: 11-30-2007
PATH NAME: 12-41 PM
PLOT SCALE: 1/4" = 1'-0"

90 KEYNOTES
THIS SHEET ONLY

ORDIZ MELBY
ARCHITECTS, INC.
5500 MING AVENUE SUITE 280
BAKERSFIELD, CALIFORNIA 93309
TELEPHONE (661) 832-5258
FACSIMILE (661) 832-4291

LICENSED ARCHITECT WILLIAM JOHN MELBY No. C- 16835 DEC. 31 2007 RENEWAL DATE STATE OF CALIFORNIA

DANNY E. ORDIZ, AIA
ARCHITECT C-14,728
WILLIAM J. MELBY, AIA
ARCHITECT C-16,835
CONSULTANT

IDENTIFICATION STAMP
DIVISION OF STATE ARCHITECT
OFFICE OF REGULATION SERVICES
APPL. 03-107003
FILE # 15-6
AC ____ FLS ____ SS ____
DATE ____

MODERNIZATION AT CURRAN MIDDLE SCHOOL FOR:

BAKERSFIELD CITY SCHOOL DISTRICT

1116 LYMRIC WAY
BAKERSFIELD
CALIFORNIA
93309

BUILDING KEY PLAN

MARK	DATE	DESCRIPTION
SD		
CD		
01	08/23/07	ADDENDUM 1
02	09/11/07	ADDENDUM 2
03	11/01/07	ADDENDUM 3

JOB NUMBER: 2002480
CAD DRAWING FILE: 12:41 PM
DRAWN BY: TT
CHECKED BY: MKB

CHECK AND VERIFY ALL DIMENSIONS BEFORE PROCEEDING WITH THE WORK. REPORT DISCREPANCIES TO THE ARCHITECT.

THE DRAWINGS, IDEAS, AND DESIGNS REPRESENTED ON THIS SHEET ARE THE PROPERTY OF THE ARCHITECT.

COPYRIGHT ORDIZ-MELBY ARCHITECTS, INC. 2002

SHEET TITLE
INTERIOR ELEVATIONS BUILDING E

SHEET IDENTIFICATION NUMBER
A-238
SHEET 27 OF 46