


Item No. 15: Refer to Sheet A-237. Elevations 7'-8" & 9" Kerolan #27 hinges refer to metal #12 at doors and #05 at vents. Reverse Kerolan #02 to head. Remove and replace existing counter top with custom countertop with 6 splash (unless noted otherwise) call to wall typical. Delete Kerolan 05 replace all doors, drawer fronts, & face plates. Finish per specifications.

KEYNOTES
 THIS SHEET ONLY

- 01 REMOVE (E) RUBBER BASE WHERE OCCURS--PROVIDE/INSTALL RISB.
- 02 REMOVE/REPLACE (E) COUNTERTOP W/CORIAN COUNTERTOP W/6" SPLASH. (UND) CALL AT WALL.
- 03 CLEAN/PREP/PAINT (E) VENT GRILL.
- 04 (E) CABINET TO REMAIN. REMOVE DOOR AND DRAWER PULLS. SAND ALL SURFACES. (DOORS, DRAWERS, SHELVES, ETC) TO REMOVE HARDWARE. REMOVE/REPLACE (E) DAMAGED AREAS. PREP & PAINT--REINSTALL HARDWARE.
- 05 PROVIDE/INSTALL PAPER TOWEL DISPENSER--SEE SPECIFICATIONS.
- 06 PATCH/FILL DAMAGED WALLS AS REQUIRED. PREP--PAINT.
- 07 (E) PLASTER WALLS.
- 08 PATCH/FILL DAMAGED WALLS AS REQUIRED. PREP--PAINT.
- 09 REMOVE/REPLACE CHALK BOARDS W/LIQUID MARKER BOARDS SEE SPECIFICATIONS.
- 10 REMOVE/REPLACE (E) TAGBOARDS--SEE SPECIFICATIONS SEE DETAIL 46/A-231 FOR MOUNTING REQUIREMENTS.
- 11 REMOVE ABANDON HEATER UNIT. CAP ALL SUPPLY/RETURN LINES BEHIND WALL. REMOVE VENT OPENING @ EXTERIOR WALL UNTIL MATCH 2X FRAMING. INSTALL INSULATION. PATCH--MATCH FINISHES--PAINT.
- 12 (E) DOOR/FRAME TO REMAIN. REPLACE HARDWARE W/ ACCESSIBLE HARDWARE. REMOVE/REPLACE (E) DAMAGED AREAS. PREP--PAINT.
- 13 (E) DOOR/FRAME TO REMAIN. SEE DOOR SCHEDULE. SAND PREPARE EXTERIOR. PAINT EXTERIOR. RE-STAIN PREVIOUSLY STAINED AREAS WHERE OCCURS.
- 14 (E) WINDOWS CLEAN/PRIME TUBE STEEL MULLIONS--PAINT.
- 15 (E) WINDOWS CLEAN/PRIME PAINTED METAL WINDOW FRAME--PAINT.
- 16 (E) WINDOWS CLEAN/PRIME WOOD TRIM (LAMB/SILL/HEAD W/OCCURS)--PAINT.
- 17 (E) WALL MOUNTED TV/BRACKET TO REMAIN.
- 18 (E) DISPLAY CASE TO REMAIN--REPLACE CORK LINING. PRIME/PAINT WOOD SURFACE.
- 19 PAINT (E) 12" X 12" ACOUSTIC WALL TILE.
- 20 REMOVE ABANDONED FIRE HOSE CABINET. CUT & CAP 2" WATER SUPPLY LINE IN WALL ABOVE OPENING FOR VERTICAL PLATFORM LIFT (SEE PLUMBING DWS).
- 21 REMOVE PORTION OF WALL TO PROVIDE OPENING FOR VERTICAL PLATFORM LIFT (SEE STRUCTURAL DWS). PATCH WALL MATCH FINISHES--PAINT--DOOR @ LOWER LANDING BY LIFT MANUFACTURE SAW-CUT/REMOVE PORTION OF WOOD PLATFORM FLOOR--INSTALL WOOD STUD WALL TO SUPPORT EXPOSED FRAMING. (SEE STRUCTURAL DWS).
- 23 SAW-CUT CONCRETE SLAB TO PROVIDE 3" DEEP PIT FOR VERTICAL PLATFORM LIFT (SEE STRUCTURAL DWS).
- 24 2 X 6 @ 16" O.C. STUDS W/5/8" TYPE "X" GYP BOARD W/1/8" FINISH VENER WALL. PARTIAL WALL TO EXTEND 4'-6" ABOVE FINISHED FLOOR OF PLATFORM--PAINT PLASTER VENER.
- 25 REMOVE/INSTALL VERTICAL PLATFORM LIFT W/3" DEEP CONCRETE PIT--SEE SPECIFICATIONS. STRUCTURAL & ELECTRICAL DWS VERIFY PIT DIMENSIONS W/MANUFACTURER.
- 26 (E) VINT. WAINSCOT TO REMAIN. (WHERE OCCURS).
- 27 PATCH WALL @ OPENING FOR VERTICAL PLATFORM LIFT--MATCH FINISHES--PAINT.
- 28 (E) IN WALL TABLES TO REMAIN.
- 29 RELOCATE ELECTRICAL LIGHT SWITCH & OUTLET AS REQUIRED SEE ELECTRICAL DRAWINGS.
- 30 (E) VINT. WALL COVERING TO REMAIN.
- 31 ELECT PANEL TO REMAIN.
- 32 CUT OPENING FOR RETURN AIR SEE MECHANICAL REPAIR WALL AS REQUIRED MATCH ALL FINISHES.

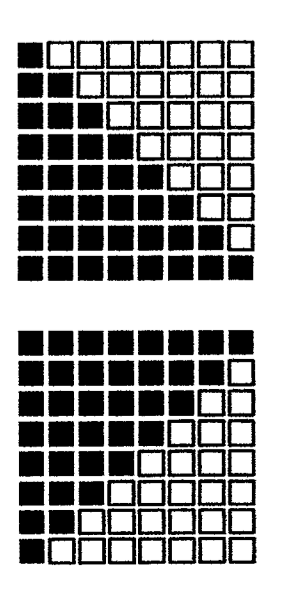

ORDIZ MELBY ARCHITECTS, INC.
 6000 KING AVENUE SUITE 200
 BAKERSFIELD, CALIFORNIA 93309
 TELEPHONE (805) 832-8288
 FACSIMILE (805) 832-4281

DANNY E. GONZ, AIA
 ARCHITECT C-A-1728
 WILLIAM J. MELBY, AIA
 ARCHITECT C-B-1885
 CONSULTANT

IDENTIFICATION STAMP
 DIVISION OF STATE ARCHITECT
 OFFICE OF REGISTRATION SERVICES
 APRIL 03-107003
 FILE # 15-6
 AC _____ FS _____ SS _____
 DATE _____

1116 LYNNIC WAY
 BAKERSFIELD
 CALIFORNIA
 93309

BAKERSFIELD
 CITY SCHOOL
 DISTRICT

MODERNIZATION AT
 CURRAN MIDDLE
 SCHOOL
 FOR:

BUILDING KEY PLAN

MARK	DATE	DESCRIPTION
SD		
CD	08/29/07	ADDENDUM 1
AD	09/11/07	ADDENDUM 2
AD	11/01/07	ADDENDUM 3

JOB NUMBER: 2002480
 DATE: 12/31/07
 DRAWN BY: [Signature]
 CHECKED BY: [Signature]

CHECK AND VERIFY ALL DIMENSIONS BEFORE REPORT PROCEEDING WITH THE CONTRACT. THE DIMENSIONS, AREA, AND DRAWING INFORMATION ON THIS SHEET ARE THE RESPONSIBILITY OF THE ARCHITECT AND NOT THE CONTRACTOR.

ORDIZ MELBY ARCHITECTS, INC. 300

INTERIOR ELEVATIONS BUILDINGS E

SHEET IDENTIFICATION NUMBER
A-237
 SHEET 28 OF 46