

NOTES:
 1. NOT ALL FIXTURES/ACCESSORIES PROJECTED OCCUR IN THIS SCHEDULE.
 2. HEIGHTS NOTED ON INTERIOR ELEVATIONS GOVERN OVER THOSE SHOWN AT HEIGHTS ACCESSIBLE TO ADULT PERSONS WITH PHYSICALLY HANDICAPPED.
 3. WATER CLOSET FLUSH VALVE SHALL BE ORIENTED TO THE WIDE SIDE OF THE ROOM/WALL.





FIXTURE	ADULT	TEEN	KINDER
TOILET CENTRELINE FROM WALL	18"	15"	12"
TOILET SEAT HEIGHT (DIMENSION TO TOP OF SEAT)	17"-19"	15"	10"-12"
GRAB BAR HEIGHT (SIDE)	33"	27"	20"-22"
TOILET PAPER IN FRONT OF TOILET	12" MAX	6" MAX	6" MAX
WAPIN DISP. IN FRONT OF TOILET	12" MAX	12" MAX	N/A
DISPENSER OR URINAL HEIGHT (TO REFLECTIVE SURFACE)	40" MAX	38" MAX	32" MAX
LAUNDRY/SINK TOP HEIGHT	34" MAX	29" MAX	24" MAX
LAUNDRY/SINK KNEE CLEARANCE	27" MIN	24" MIN	14" MIN
DRINKING FOUNTAIN KNEE CLEARANCE	44" MAX	37" MAX	32" MAX
DRINKING FOUNTAIN KNEE CLEARANCE	38" MAX	32" MAX	22" MAX
DRINKING FOUNTAIN KNEE CLEARANCE	27" MIN	24" MAX	22" MIN
DRINKING FOUNTAIN KNEE CLEARANCE	34"-38" MAX	27"	22"

1 STANDARD MOUNTING HEIGHT SCHEDULE

4 MOUNTING HEIGHTS

5 HC CLEARANCES

6 HC CLEARANCES

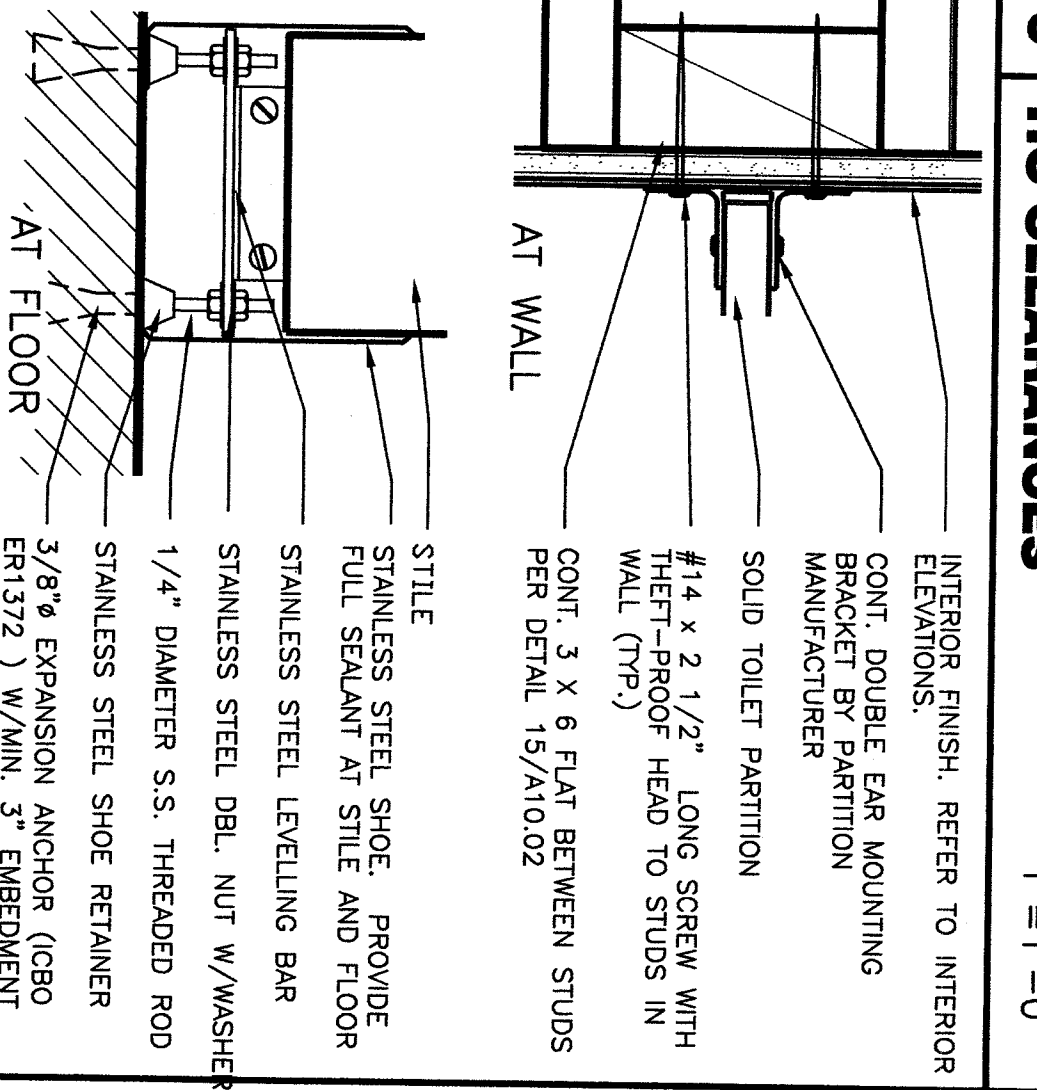
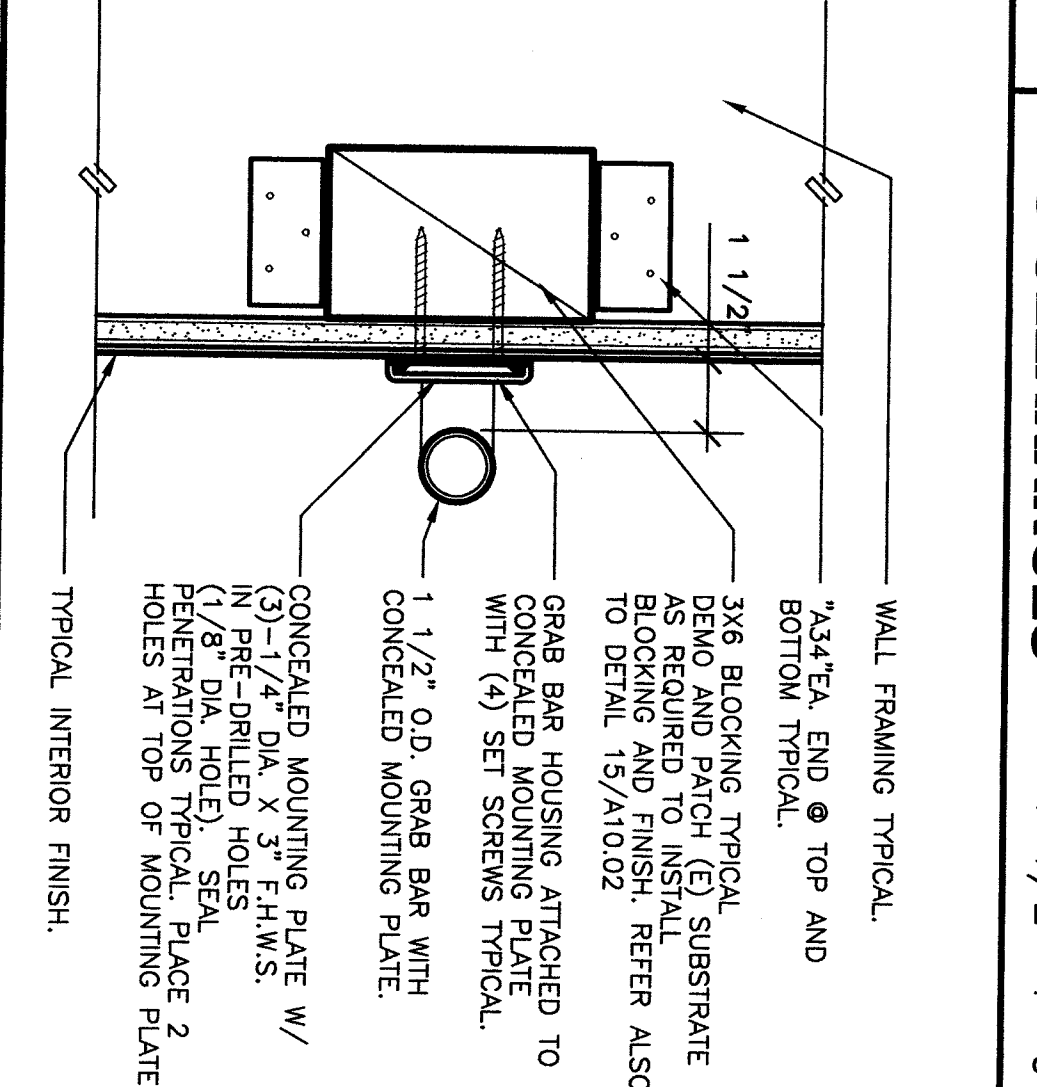
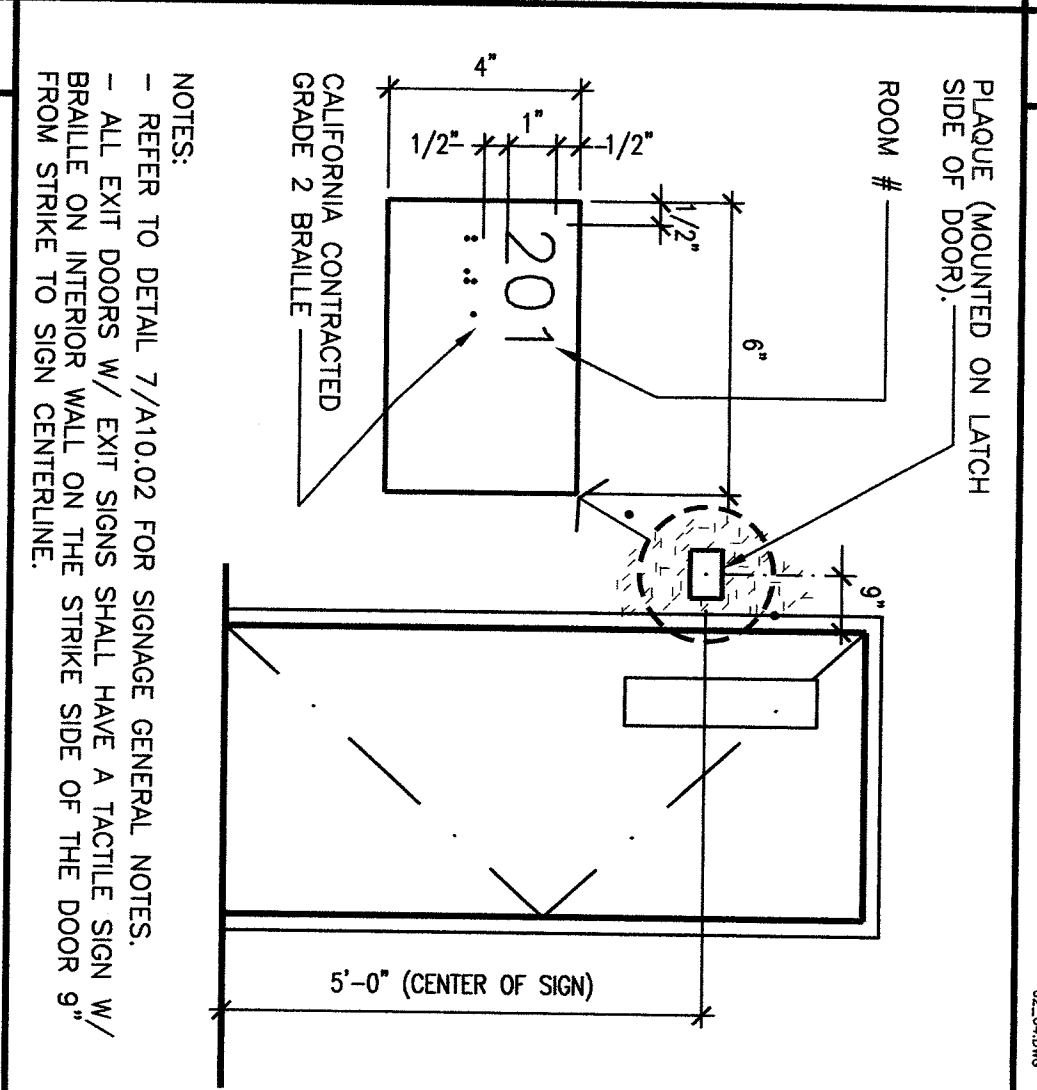
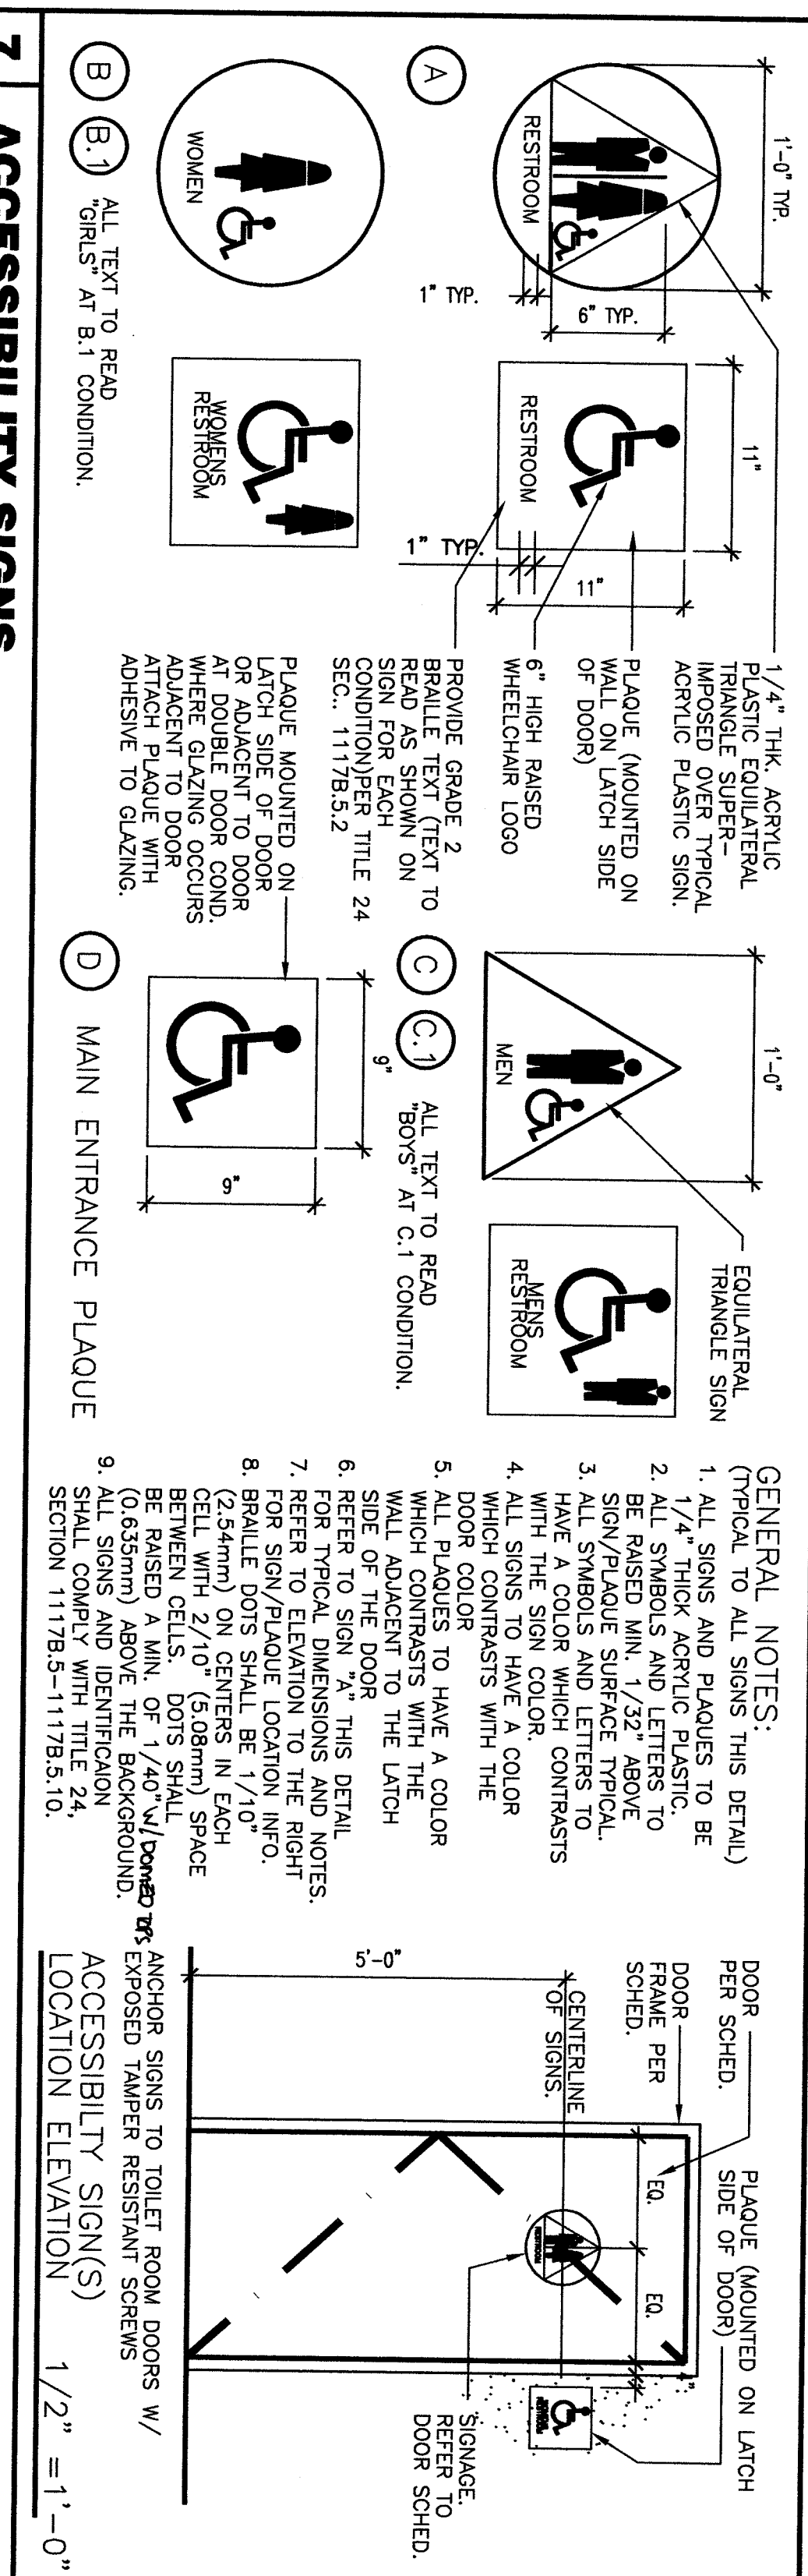


7 ACCESSIBILITY SIGNS

10 ELEVATION

11 GRAB BAR BLOCKING

12 TOILET PARTITION

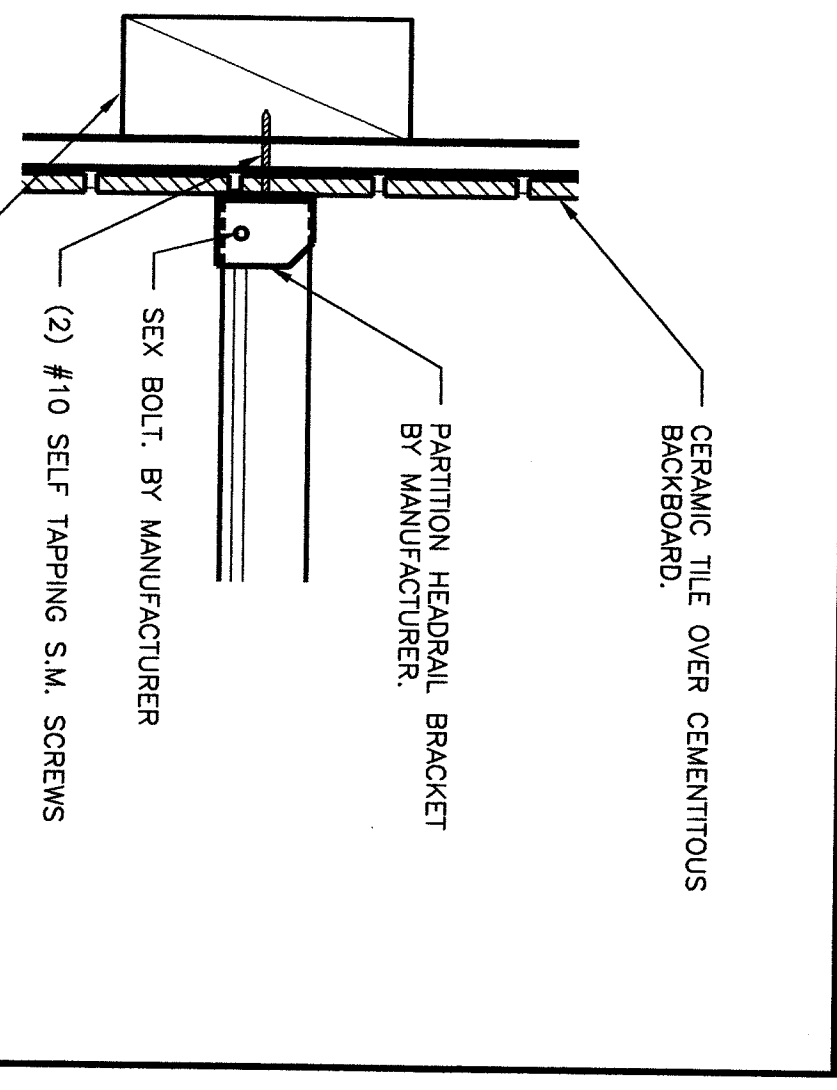
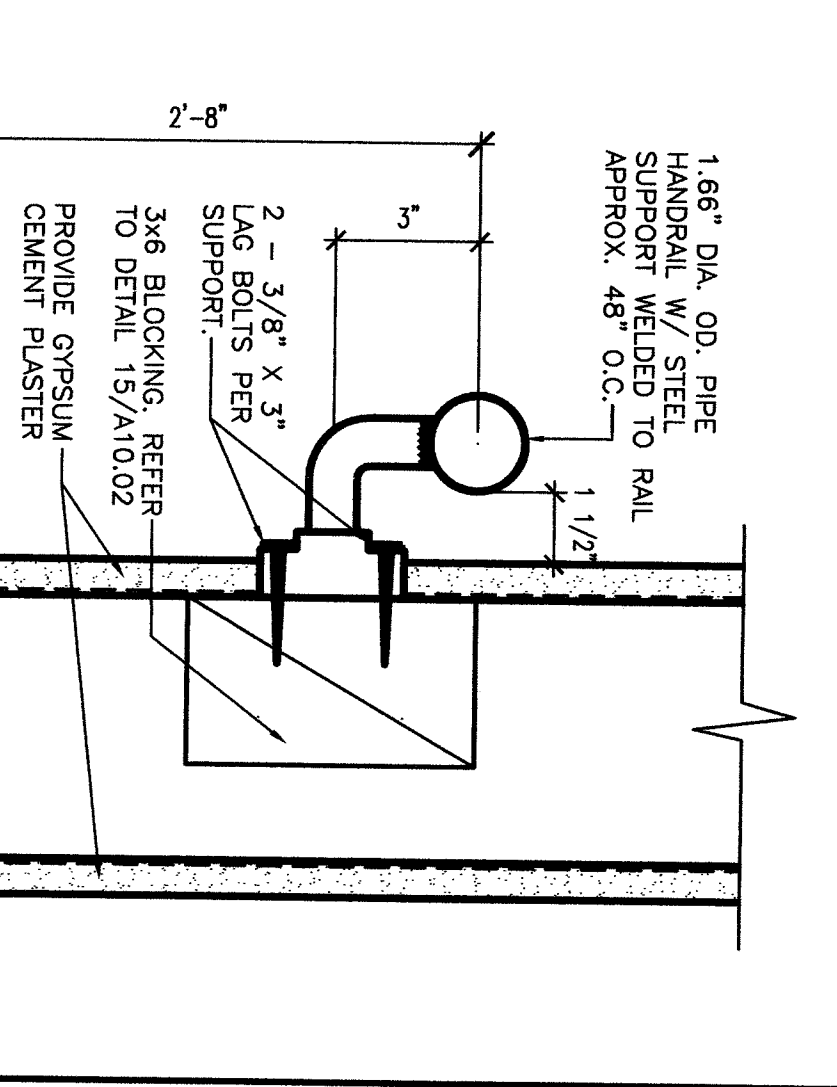
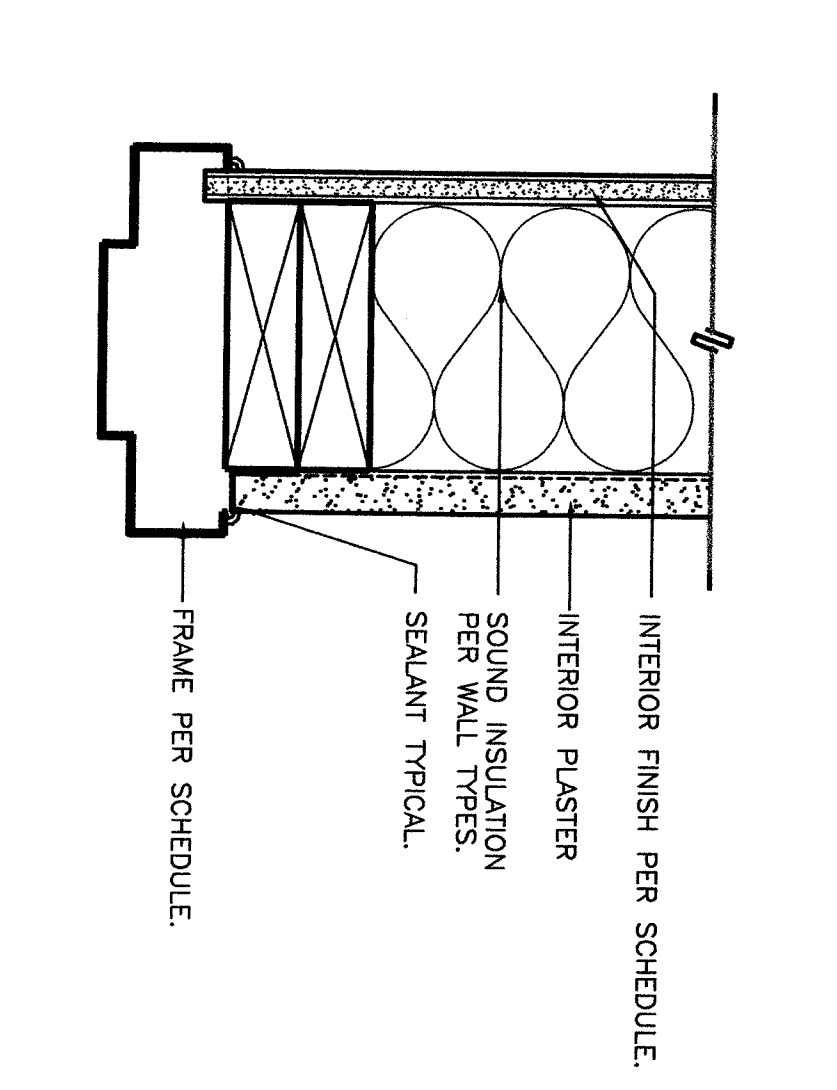
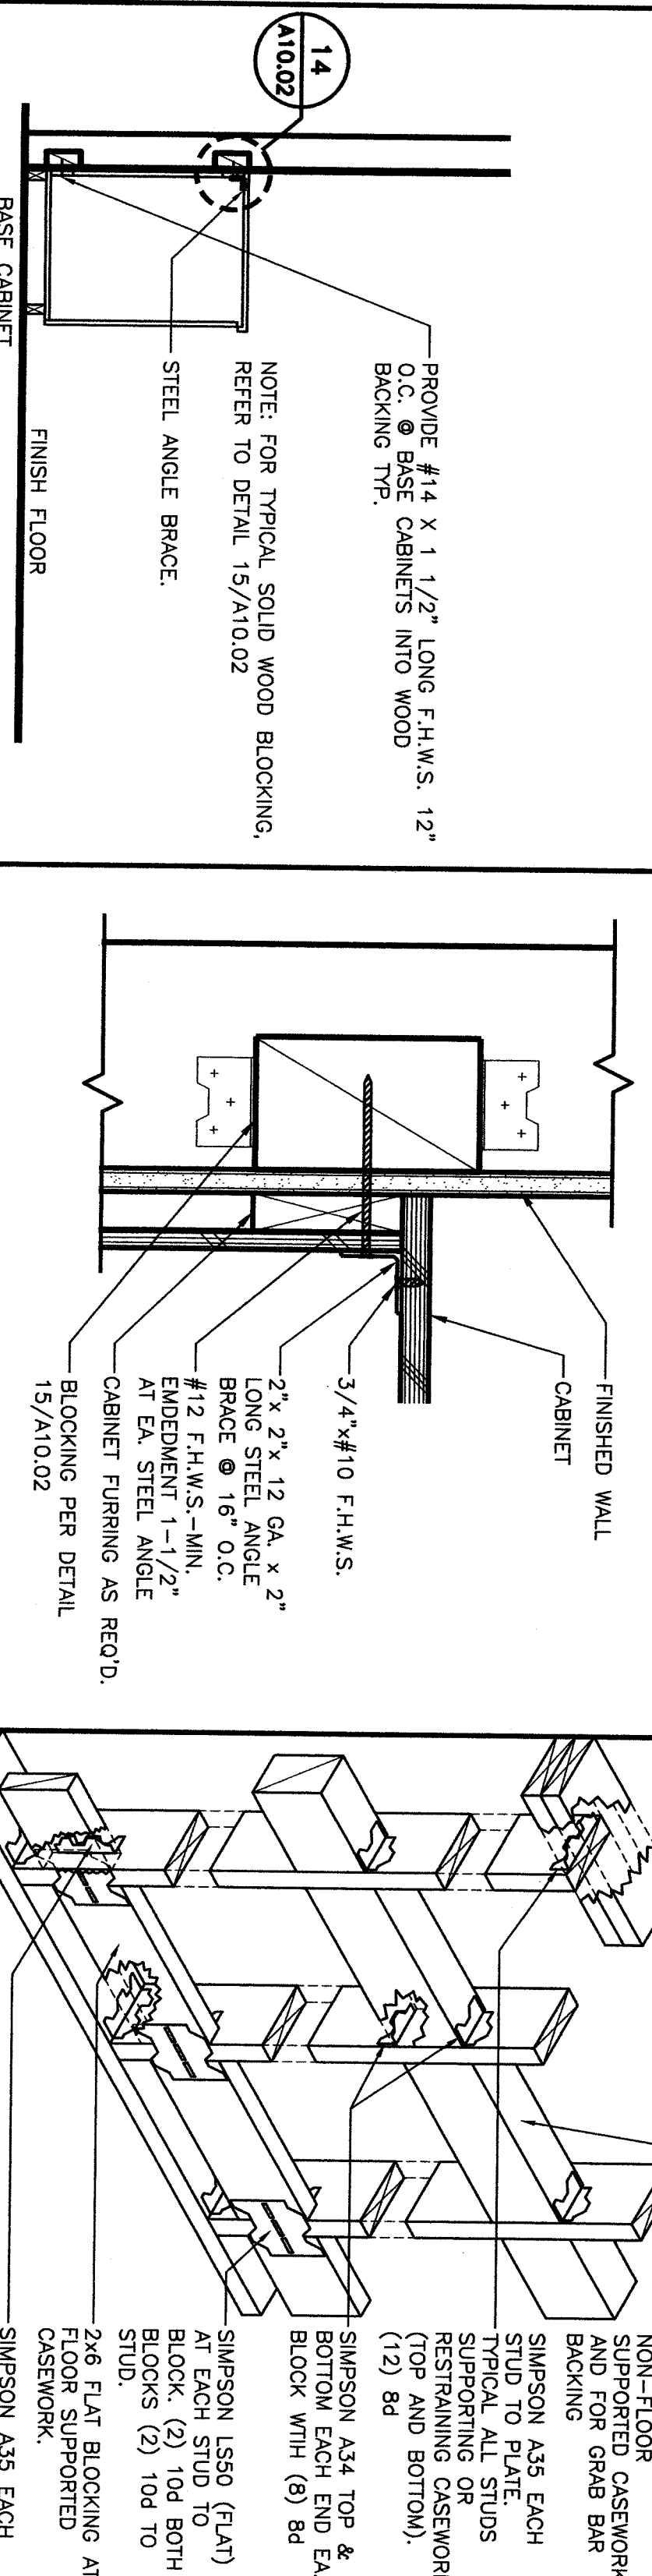


13 BASE/UPPER CABINET

14 CABINET ANCHORAGE

15 TYPICAL BLOCKING

16 PLAN

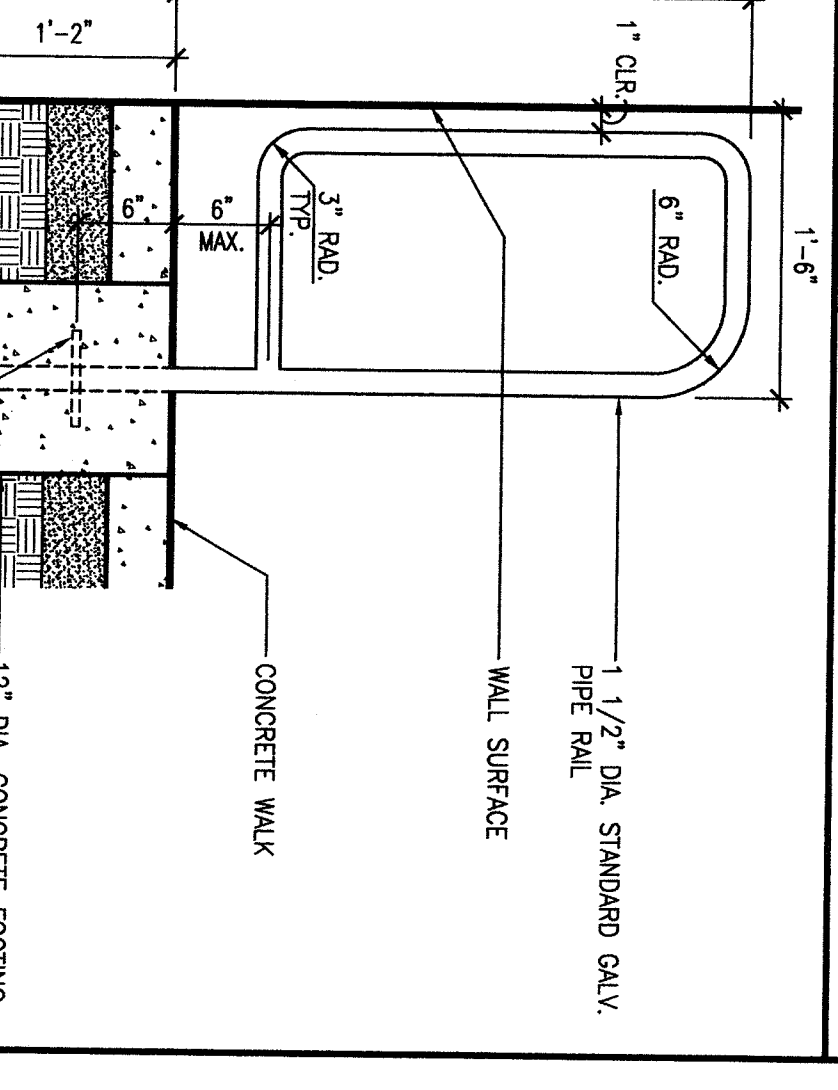
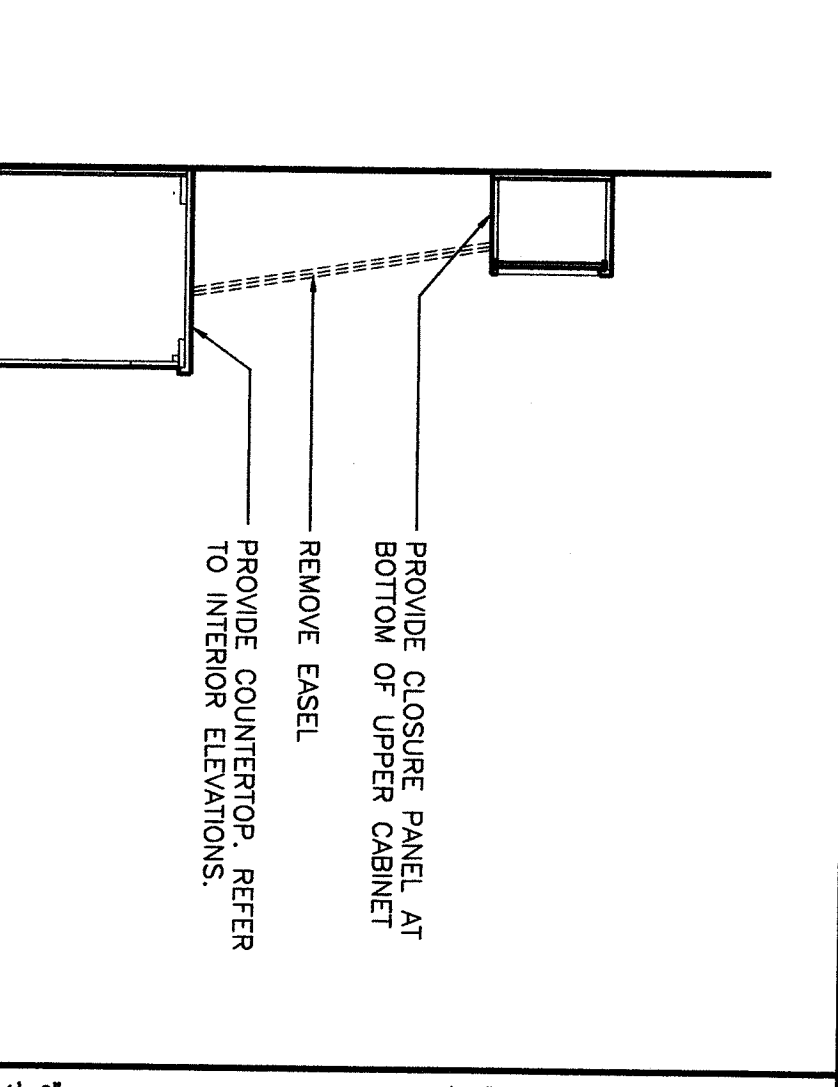
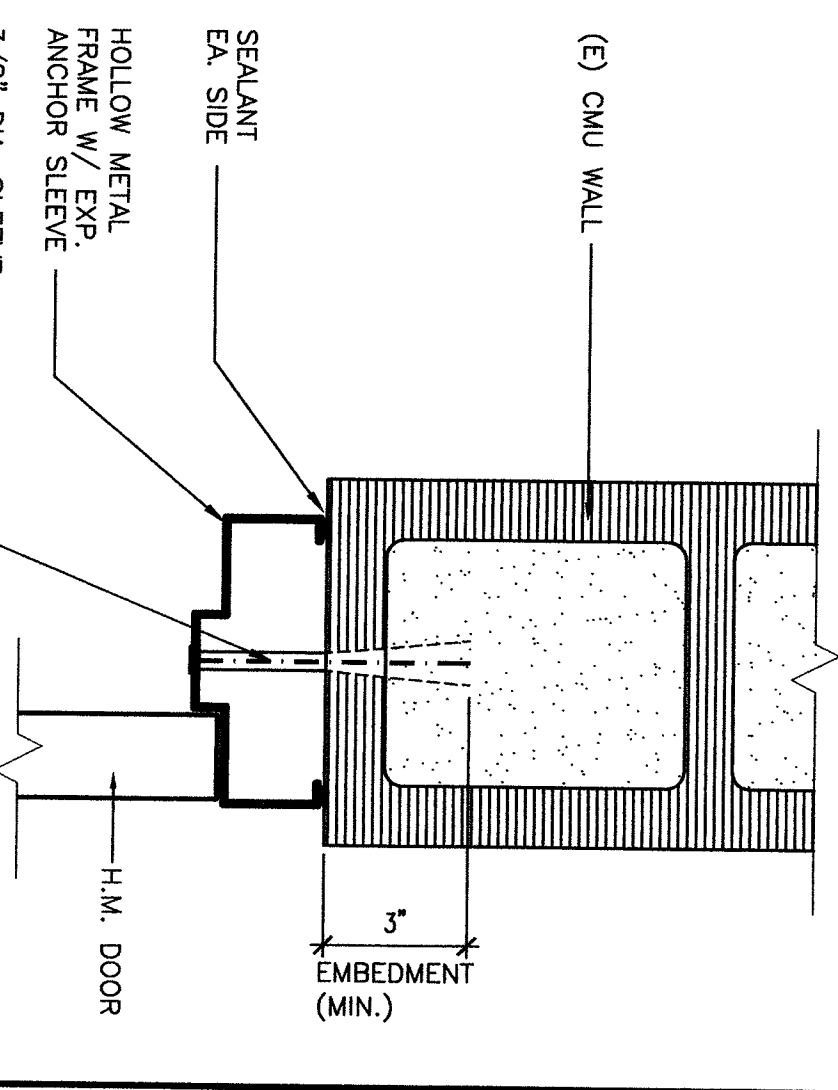
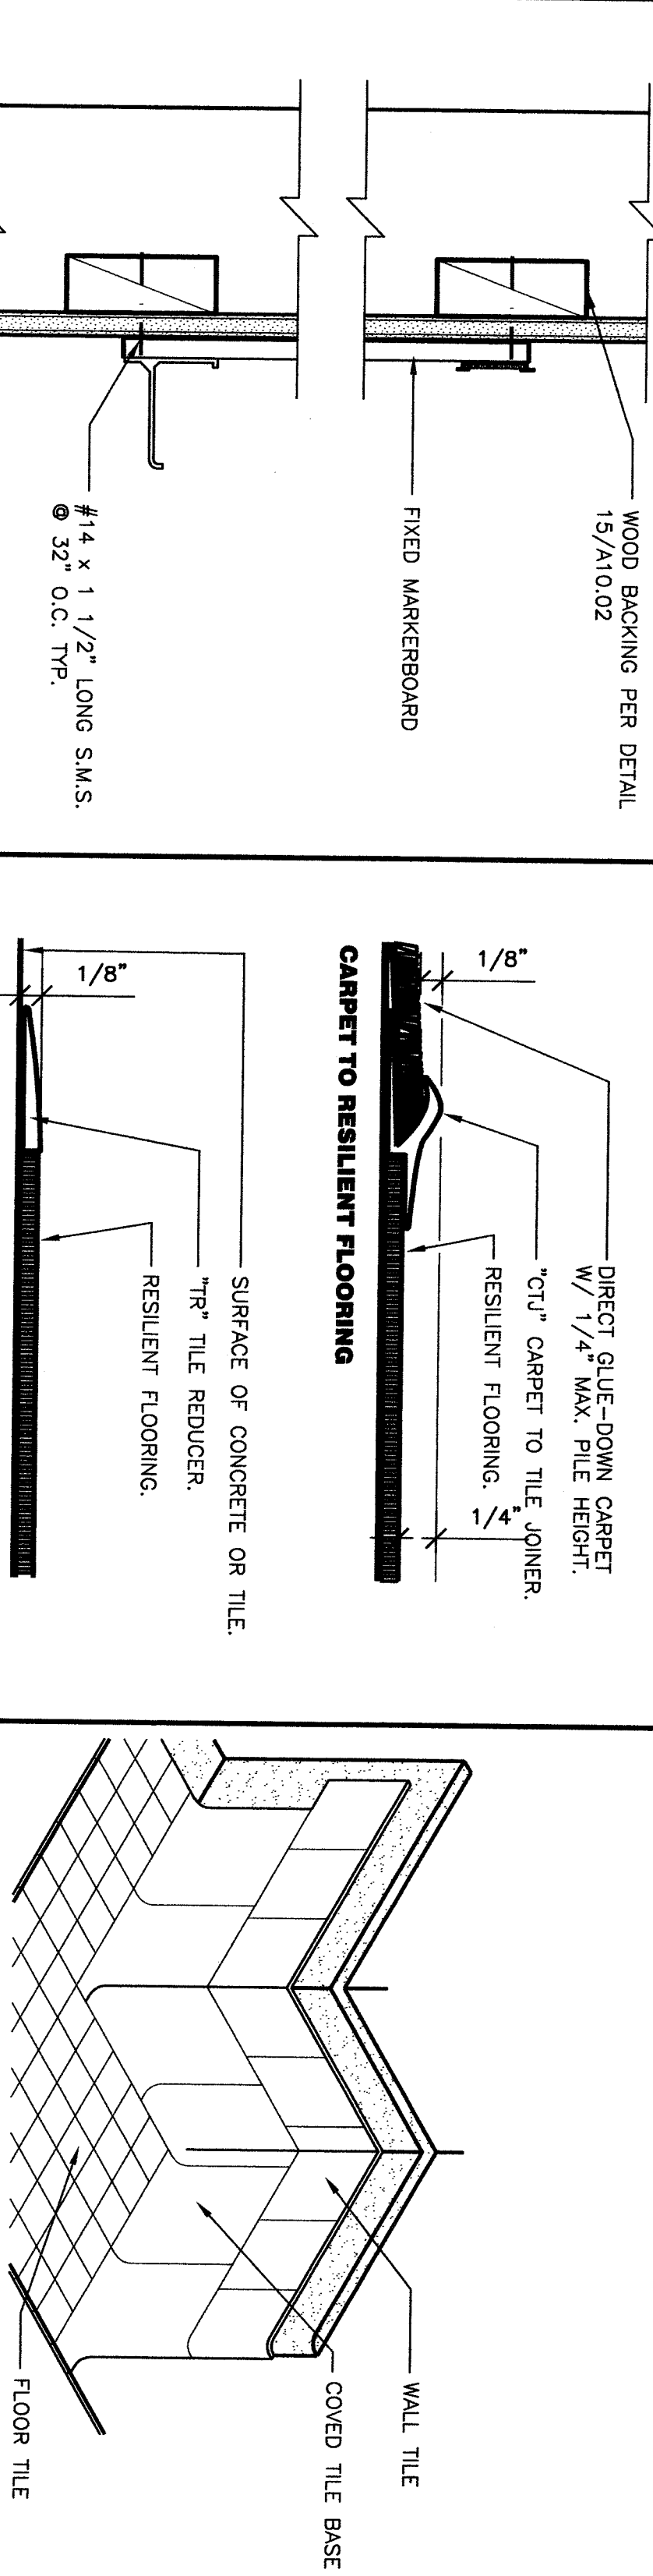


19 MARKERBOARD

20 MATERIAL TRANSITIONS

21 TILE CORNER

22 JAMB / HEAD (SIM.)

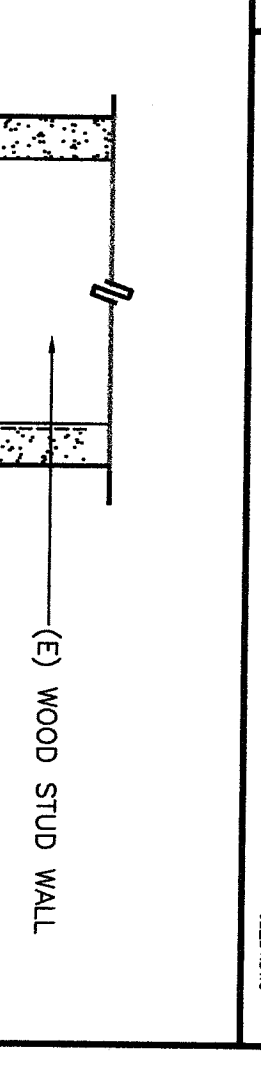
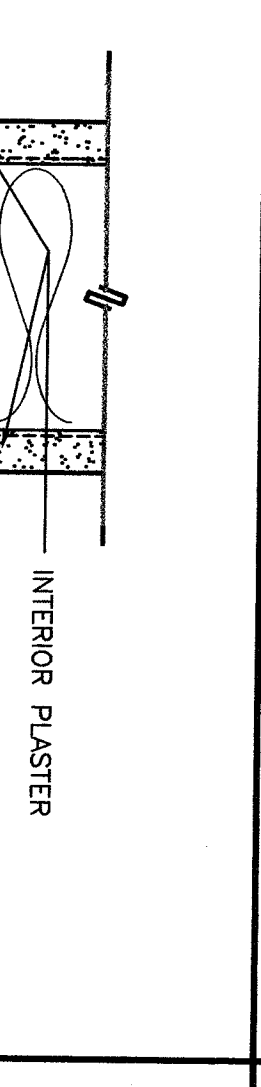
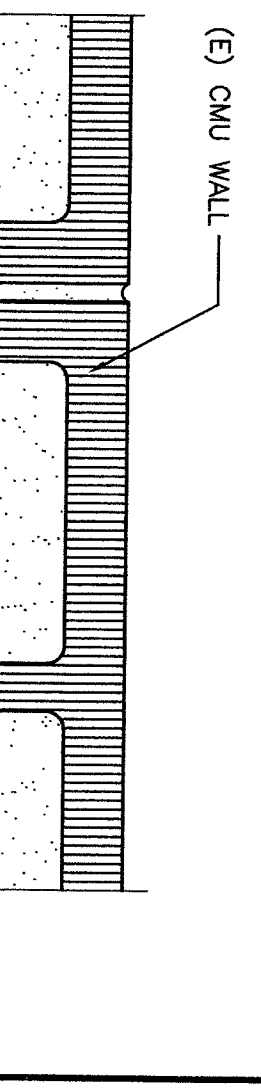
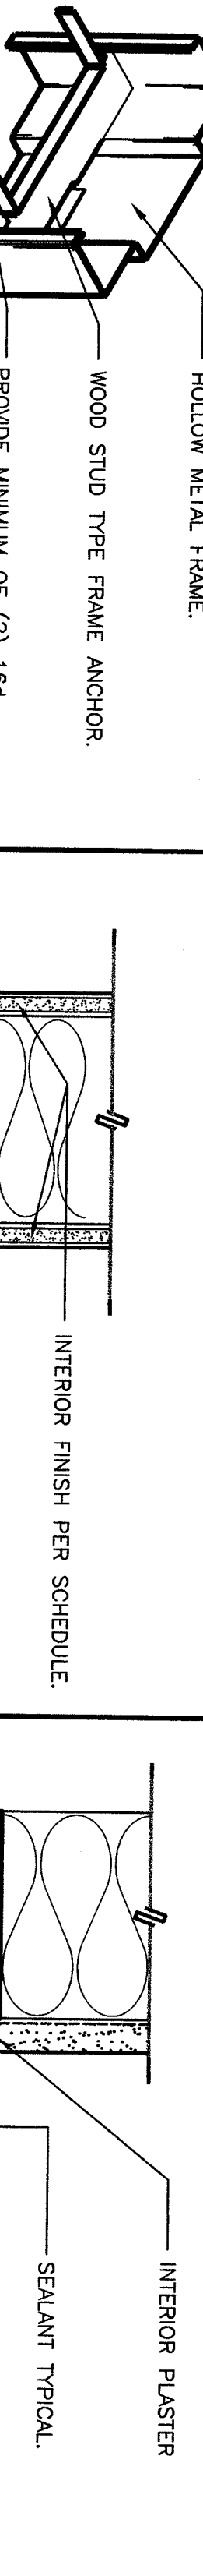


25 JAMB ANCHORS

26 JAMB


27 JAMB

28 JAMB

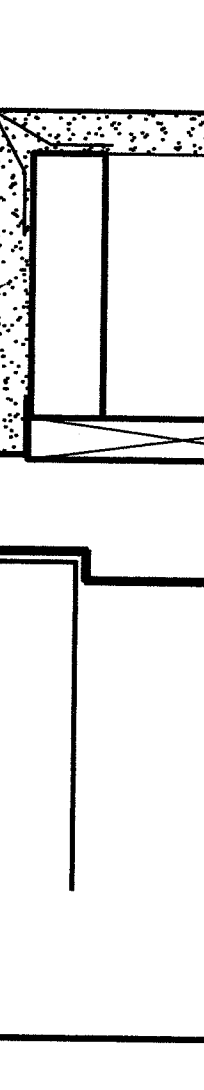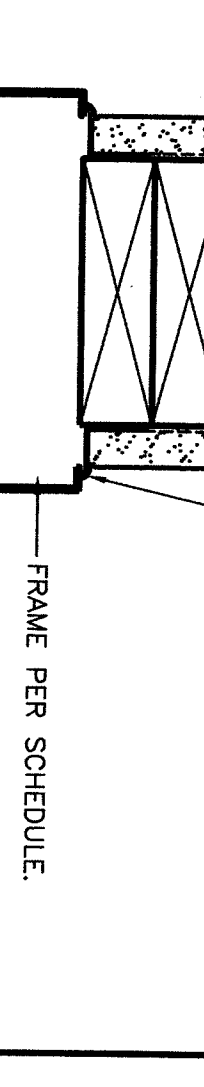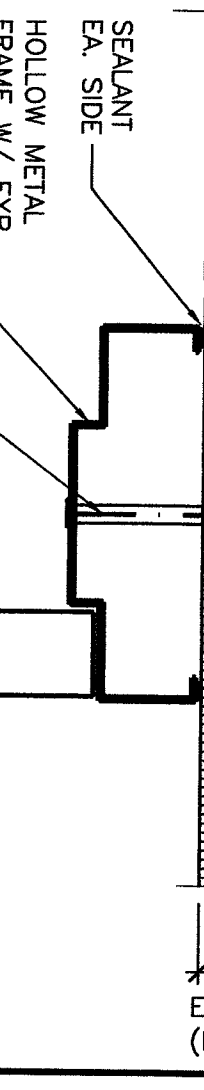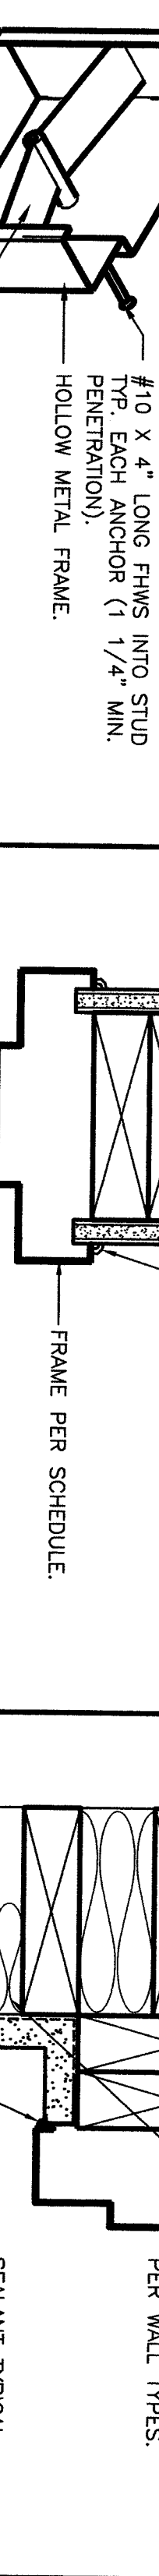

29 JAMB

30 JAMB

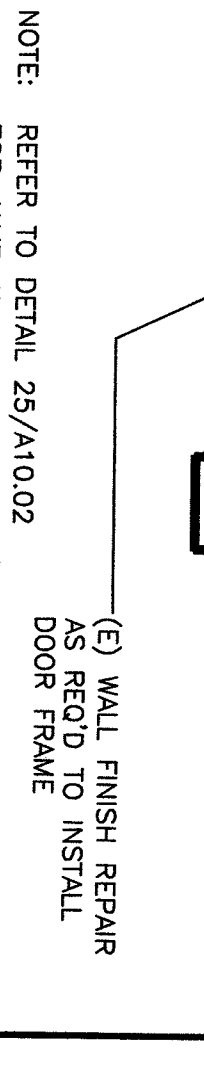

bjc
 Architecture
Bakersfield
 5900 Ming Avenue, Suite 450, Bakersfield, CA 93309
 Tel: 805.836.4300

San Jose
 150 South First St., Suite 200
 San Jose, CA 95113
 Tel: 408.974.0041

San Luis Obispo
 4115 La Grana, Suite 100
 San Luis Obispo, CA 93401
 Tel: 805.546.0334

Oakland
 300 Frank Ogawa Plaza, Suite 300
 Oakland, CA 94612
 Tel: 916.899.1951

Principal Architects
 5900 Ming Avenue, Suite 450, Bakersfield, CA 93309
 Tel: 805.836.4300

MODERNIZATION
 FOR
COLONEL HOWARD NICHOLS
SCHOOL
3401 RENEGADE AVE.
BAKERSFIELD, CA. 93306

BAKERSFIELD CITY
SCHOOL DISTRICT

FILE NO. 15-8
 IDENTIFICATION NUMBER
 DIV. OF THE STATE ARCHITECT
 APR. NO. 03-108864
 AC 87 15-8-03
 DATE 8-26-03

DETAILS

Version Date: 02-12-17
 date: 8-26-03
 drawn by: DESA
 chd'd by: R. TROST
 ©copy/rlt 2002

Version Date: 02-12-17
 date: 8-26-03
 drawn by: DESA
 chd'd by: R. TROST
 ©copy/rlt 2002